The Road Inventory of Pixley National Wildlife Refuge Tulare, CA





Prepared By: Federal Highway Administration Central Federal Lands Highway Division March 2012



TABLE OF CONTENTS

<u>SECTION</u>		<u>PAGE</u>
I.	INTRODUCTION	1 - 1
II.	Summaries by Condition, Surface Type and Functional Class	2 - 1
III.	REFUGE ROUTE LOCATION MAPS	3 - 1
IV.	ROUTE IDENTIFICATION LIST	4 - 1
V.	ROUTE CONDITION RATING SHEETS	5 - 1
VI.	PARKING LOT CONDITION RATING SHEETS	6 - 1
VII.	BRIDGE INVENTORY INFORMATION	7 - 1
VIII.	PHOTOGRAPHIC SHEETS	8 - 1
IX.	ACCIDENT SUMMARY	9 - 1
	APPENDIX Functional Classification Table Description of Rating System	i ii

INTRODUCTION

The Transportation Equity Act for the 21st Century (Public Law 105-178) created the Refuge Roads Program. Refuge roads are those public roads that provide access to or within a unit of the National Wildlife Refuge System and for which title and maintenance responsibility is vested in the United States Government. Funds from the Highway Trust Fund are available for refuge roads and can be used by the station to pay the cost of:

- (a) Maintenance and improvements of refuge roads.
- (b) Maintenance and improvements of:
 - (1) Adjacent vehicle parking areas
 - (2) Provision for pedestrians and bicycles and
 - (3) Construction and reconstruction of roadside rest areas that are located in or adjacent to wildlife refuges
- (c) Administrative costs associated with such maintenance and improvements.

The funds available for refuge roads are to be disbursed based on the relative needs of the various refuges in the National Wildlife Refuge System, and taking into consideration:

- (a) The comprehensive conservation plan for each refuge;
- (b) The need for access as identified through land use planning; and
- (c) The impact of land use planning on existing transportation facilities.

To determine the relative needs of the U.S. Fish and Wildlife Service, the Federal Highway Administration (FHWA) was asked to inventory all public access roads and parking lots and provide a condition assessment of each. In 2008 the inventory was expanded to include administrative (service use only) roads and parking lots. An FHWA representative meets with refuge personnel to identify route segments and assign route numbers and functional classifications (See Appendix) for each route. All roads and parking lots are mapped using Trimble GPS units and visually assessed for condition using the RSL method of evaluation developed at Utah State University (See Appendix). Culverts, Gates, Guardrails and Low Water Crossings are also mapped and inspected for any obvious defects.

An estimate is provided, in year 2008 dollars, based on the condition determined by the rating system. Estimates are based upon data and location factors from the 2008 RS Means Heavy Construction Cost Data 22nd Annual Edition. Cost estimates should be evaluated on a case-by-case basis when being used for programming purposes.

Native Surfaced roads and parking lots already inventoried will not be re-inventoried and will not appear individually in report chapters 5, 6 and 8. Mileages and areas of native surfaced roads and parking lots will still appear in all summaries in the report and will remain in the road inventory database. In addition to this report, the FHWA will furnish the condition ratings of each route and segment to the Fish and Wildlife Service in a Microsoft Access database so the data can be included in their Real Property Inventory.

Pixley NWR - 81612

Summaries

Route Miles and Percentages by Functional Class and Condition

Condition Rating (Based on RSL)*

	Exce	ellent	Go	ood	Fa	air	Po	or	Fai	iled	TOTAL
F. C.	MILES	%	MILES	%	MILES	%	MILES	%	MILES	%	MILES
ı	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00
II	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00
III	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00
IV	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00
٧	0.65	5.3%	11.64	94.7%	0.00	0.0%	0.00	0.0%	0.00	0.0%	12.29
Totals	0.65	5.3%	11.64	94.7%	0.00	0.0%	0.00	0.0%	0.00	0.0%	12.29

^{*}For a description of condition ratings for the various surface types see the Appendix.

Route Miles and Percentages by Surface Type and Condition

Paved Condition Rating [Condition(RSL)]

	Exce	ellent	Go	od	Fa	air	Po	or	Fai	iled	TOTAL
Surface	MILES	%	MILES	%	MILES	%	MILES	%	MILES	%	MILES
AS	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00
CO	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00
Totals	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00

Unpaved Condition Rating [Condition(RSL)]

				•			` /1				
	Exce	ellent	Go	ood	Fa	air	Po	oor	Fai	iled	TOTAL
Surface	MILES	%	MILES	%	MILES	%	MILES	%	MILES	%	MILES
GR	0.00	0.0%	11.64	100.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	11.64
NA	0.65	100.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.65
PR	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00
Totals	0.65	5.3%	11.64	94.7%	0.00	0.0%	0.00	0.0%	0.00	0.0%	12.29

Square Footage (Parking Areas)

	Exce	ellent	Go	od	F	air	Po	or	Fail	led	Total
	Square		Square		Square		Square		Square		Square
Surface	Feet	%	Feet	%	Feet	%	Feet	%	Feet	%	Feet
AS	0	0.0%	0	0.0%	0	0.0%	0	0.0%	0	0.0%	0
co	0	0.0%	0	0.0%	0	0.0%	0	0.0%	0	0.0%	0
GR	0	0.0%	15,683	100.0%	0	0.0%	0	0.0%	0	0.0%	15,683
NA	0	0.0%	0	0.0%	0	0.0%	0	0.0%	0	0.0%	0
PR	0	0.0%	0	0.0%	0	0.0%	0	0.0%	0	0.0%	0
Totals	0	0.0%	15,683	100.0%	0	0.0%	0	0.0%	0	0.0%	15,683

Pixley NWR - 81612 Summaries


Route Miles and Percentages by Use Type and Condition Road Condition Rating: Public/Administrative Use

USE	Exce	ellent	Go	ood	Fa	air	Po	or	Fai	led	TOTAL
TYPE	MILES	%	MILES	%	MILES	%	MILES	%	MILES	%	MILES
Public (FC I-III)	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00	0.0%	0.00
Admin (FC IV-V)	0.65	5.3%	11.64	94.7%	0.00	0.0%	0.00	0.0%	0.00	0.0%	12.29
Totals	0.65	5.3%	11.64	94.7%	0.00	0.0%	0.00	0.0%	0.00	0.0%	12.29

Parking Condition Rating: Public/Administrative Use

				9	<u> </u>						
USE	Exce	ellent	Go	ood	Fa	air	Po	or	Fail	ed	Total
TYPE	Sq Ft	%	Sq Ft	%	Sq Ft	%	Sq Ft	%	Sq Ft	%	Sq Ft
Public	0	0.0%	15683	100.0%	0	0.0%	0	0.0%	0	0.0%	15,683
Admin	0	0.0%	0	0.0%	0	0.0%	0	0.0%	0	0.0%	0
Totals	0	0.0%	15,683	100.0%	0	0.0%	0	0.0%	0	0.0%	15,683

Pixley National Wildlife Refuge ROUTE LOCATION MAP

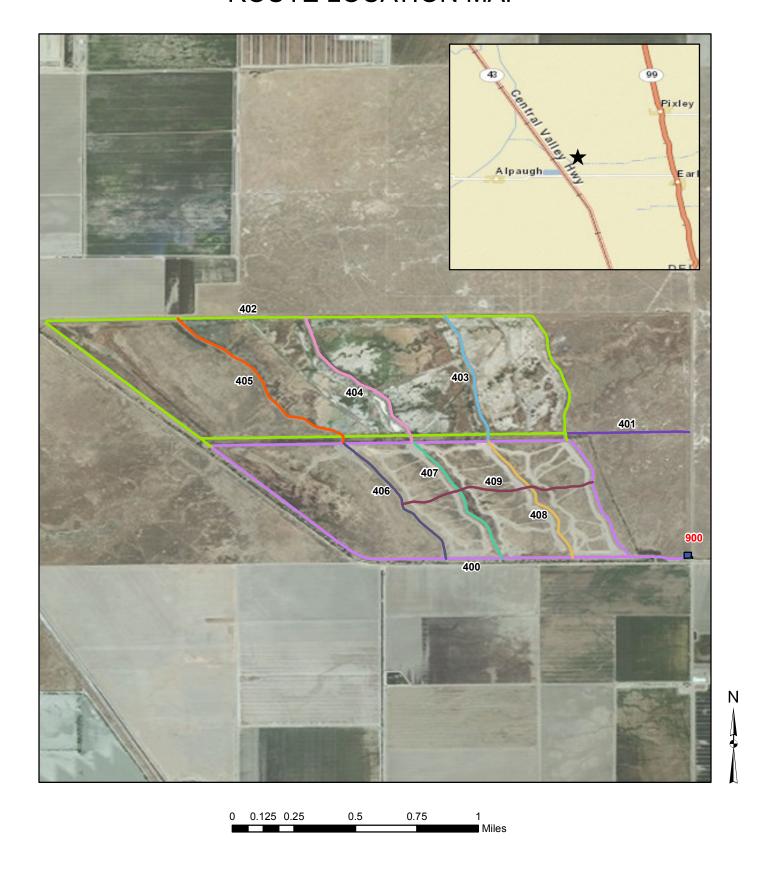

Pixley NWR - 81612 Route Identification List

Shading Color Key:

White = Paved Routes

Yellow = Unpaved Routes

RTE#	Asset Number	ROUTE NAME	RTE MI	ROUTE DESCRIPTION	PAVED MI	UN- PAVED MI	LANES	FC
400	1	Wetland Units 6,7,8,9 Boundary Road	3.44	From Road 88 around wetland units 6,7,8,9	-	3.44	1	5
401	•	East Side Groundwater Well Road	0.41	From Road 88 to Wetland Units 1,2,3,4 Boundary Road (Route 402)	i	0.41	1	5
402	-	Wetland Units 1, 2, 3, 4 Boundary Road	4.09	From Wetland Units 6,7,8,9 Boundary Road (Route 400) around Wetland Units 1,2,3,4	i	4.09	1	5
403	-	Wetland Units 3, 3A, 4 Cross Dike Road	0.54	From Wetland Units 6,7,8,9 Boundary Road (Route 400) to Wetland Units 1, 2, 3, 4 Boundary Road (Route 402)	ı	0.54	1	5
404	-	Wetland Units 2, 3, 3A Cross Dike Road	0.65	From Wetland Units 6,7,8,9 Boundary Road (Route 400) to Wetland Units 1, 2, 3, 4 Boundary Road (Route 402)	ı	0.65	1	5
405	-	Wetland Units 1, 2A Cross Dike Road	0.79	From Wetland Units 6,7,8,9 Boundary Road (Route 400) to Wetland Units 1, 2, 3, 4 Boundary Road (Route 402)	ı	0.79	1	5
406	-	Wetland Units 6, 7 Cross Dike Road	0.59	From Wetland Units 6,7,8,9 Boundary Road (Route 400) to Wetland Units 6,7,8,9 Boundary Road (Route 400)	-	0.59	1	5
407	-	Wetland Units 7, 8 Cross Dike Road	0.56	From Wetland Units 6,7,8,9 Boundary Road (Route 400) to Wetland Units 6,7,8,9 Boundary Road (Route 400)	-	0.56	1	5
408	-	Wetland Units 8, 9 Cross Dike Road	0.57	From Wetland Units 6,7,8,9 Boundary Road (Route 400) to Wetland Units 6,7,8,9 Boundary Road (Route 400)	ı	0.57	1	5
409	-	Wetland Units 7, 8, 9 Center Levee Road	0.65	From Wetland Units 6,7,8,9 Boundary Road (Route 400) to Wetland Units 6, 7 Cross Dike Road (Route 406)	-	0.65	1	5

Pixley NWR - 81612

Route Identification List (Parking)

Shading Color Key:

White = Paved Routes	
Green = Unpaved Routes	

9	900	1000296	Pixley Trailhead Parking		From Road 88	Gravel
R	loute #	Asset Number	ROUTE NAME	Area (Sq Ft)	ROUTE DESCRIPTION	Surface Type

CHANGES TO THE FISH AND WILDLIFE SERVICE ROAD INVENTORY REPORT


Pixley NWR

		Routes added to previous inventory:	
Rte #	Rte Name	Reason For Addition	
400	Wetland Units 6,7,8,9 Boundary Road	New Administrative Route	
401	East Side Groundwater Well Road	New Administrative Route	
402	Wetland Units 1, 2, 3, 4 Boundary Road	New Administrative Route	
403	Wetland Units 3, 3A, 4 Cross Dike Road	New Administrative Route	
404	Wetland Units 2, 3, 3A Cross Dike Road	New Administrative Route	
405	Wetland Units 1, 2A Cross Dike Road	New Administrative Route	
406	Wetland Units 6, 7 Cross Dike Road	New Administrative Route	
407	Wetland Units 7, 8 Cross Dike Road	New Administrative Route	
408	Wetland Units 8, 9 Cross Dike Road	New Administrative Route	
409	Wetland Units 7, 8, 9 Center Levee Road	New Administrative Route	

	Routes removed from previous inventory:						
Rte #	Rte Name	Reason For Removal					

	Routes n	nodified from previous inventory:	
Rte #	Rte Name	Type of Modification	Description of Modification

Comments:			

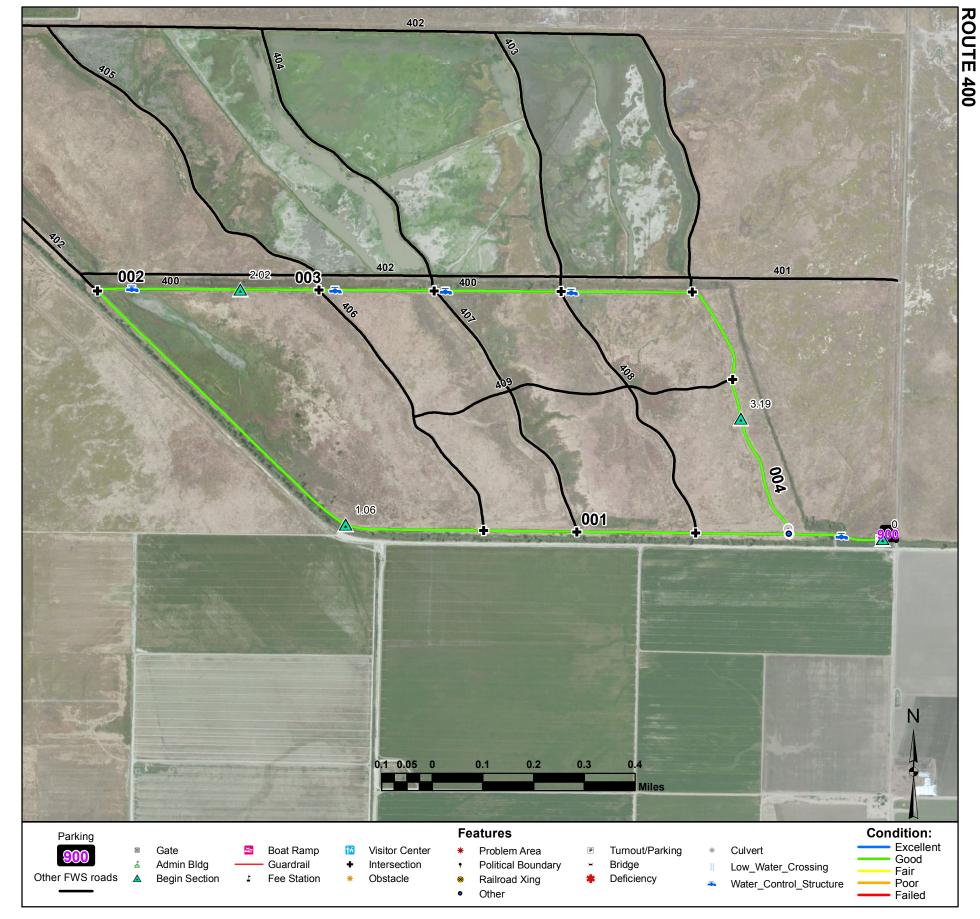


Wetland Units 6,7,8,9 Boundary Road

From Road 88 around wetland units 6,7,8,9

Route Number: 400 Total Route Mileage: 3.44

Asset Number	-	-	-	-	
Section Number	001	002	003	004	
Section Length (miles)	1.06	0.96	1.17	0.25	
Inspection Date	12-14-2011	12-14-2011	12-14-2011	12-14-2011	
Surface Type	Gravel	Gravel	Gravel	Gravel	
Number of Lanes	1	1	1	1	
Roadway Width (feet)	12	12	12	12	
Condition	Good	Good	Good	Good	
Remaining Service Life (years)	5	5	5	7	
Estimated Cost to Repair	\$2,100	\$1,900	\$2,300	\$500	
Current Replacement Value	\$879,500	\$792,900	\$970,400	\$208,500	

Features	Mile Post	Features	Mile Post	Features	Mile Post	Features	Mile Post
Begin Section Gate Other Water Control Structure Intersection Intersection Begin Section Intersection Water Control Structure Begin Section Intersection Water Control Structure Begin Section Intersection Water Control Structure	001-0.0 001-0.0 001-0.0 001-0.08 001-0.37 001-0.6 001-0.79 002-1.06 002-1.72 002-1.79 003-2.02 003-2.18 003-2.21	Intersection Water Control Structure Intersection Intersection Begin Section Culvert Other	003-2.68 003-2.7 003-2.94 003-3.12 004-3.19 004-3.43 004-3.44	Teatures	Mile Post	reatures	Mile Post
Intersection Water Control Structure	003-2.42 003-2.44						

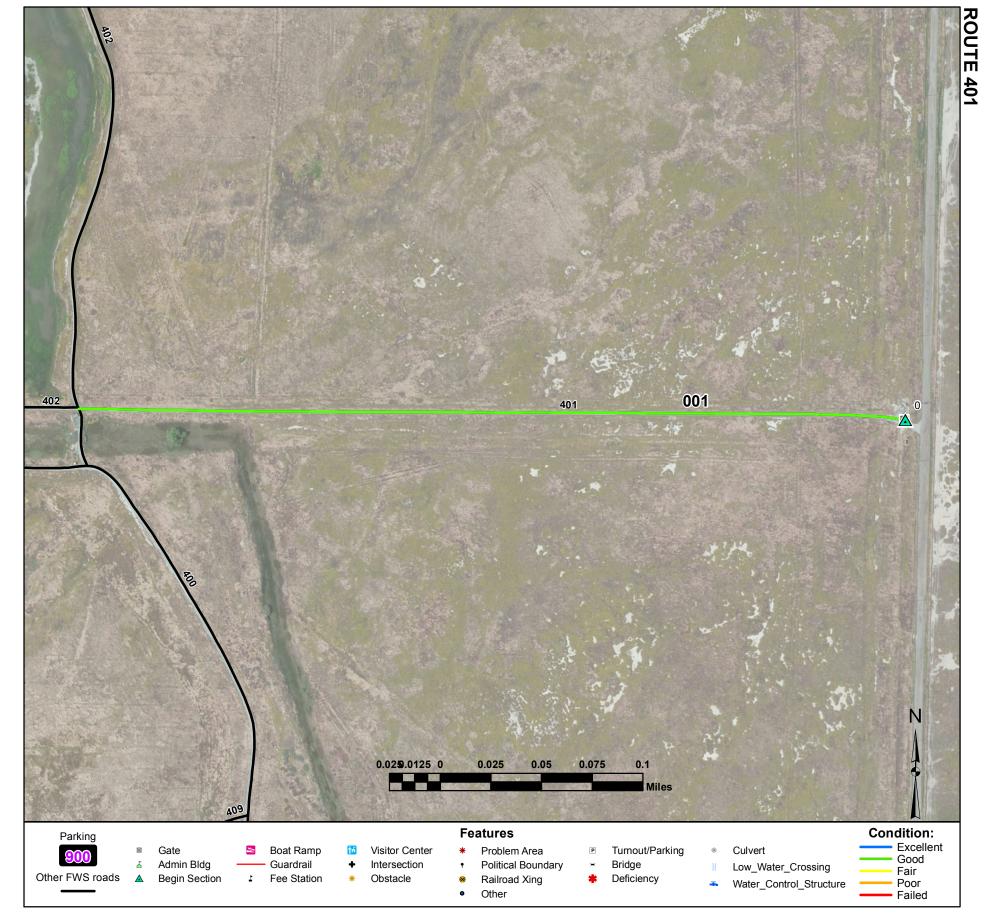


East Side Groundwater Well Road

From Road 88 to Wetland Units 1,2,3,4 Boundary Road (Route 402)

Route Number: 401 Total Route Mileage: 0.41

Asset Number	-
Section Number	001
Section Length (miles)	0.41
Inspection Date	12-14-2011
Surface Type	Gravel
Number of Lanes	1
Roadway Width (feet)	12
Condition	Good
Remaining Service Life (years)	7
Estimated Cost to Repair	\$800
Current Replacement Value	\$337,800

Features	Mile Post	Features	Mile Post	Features	Mile Post	Features	Mile Post
Begin Section Gate	001-0.0 001-0.0						

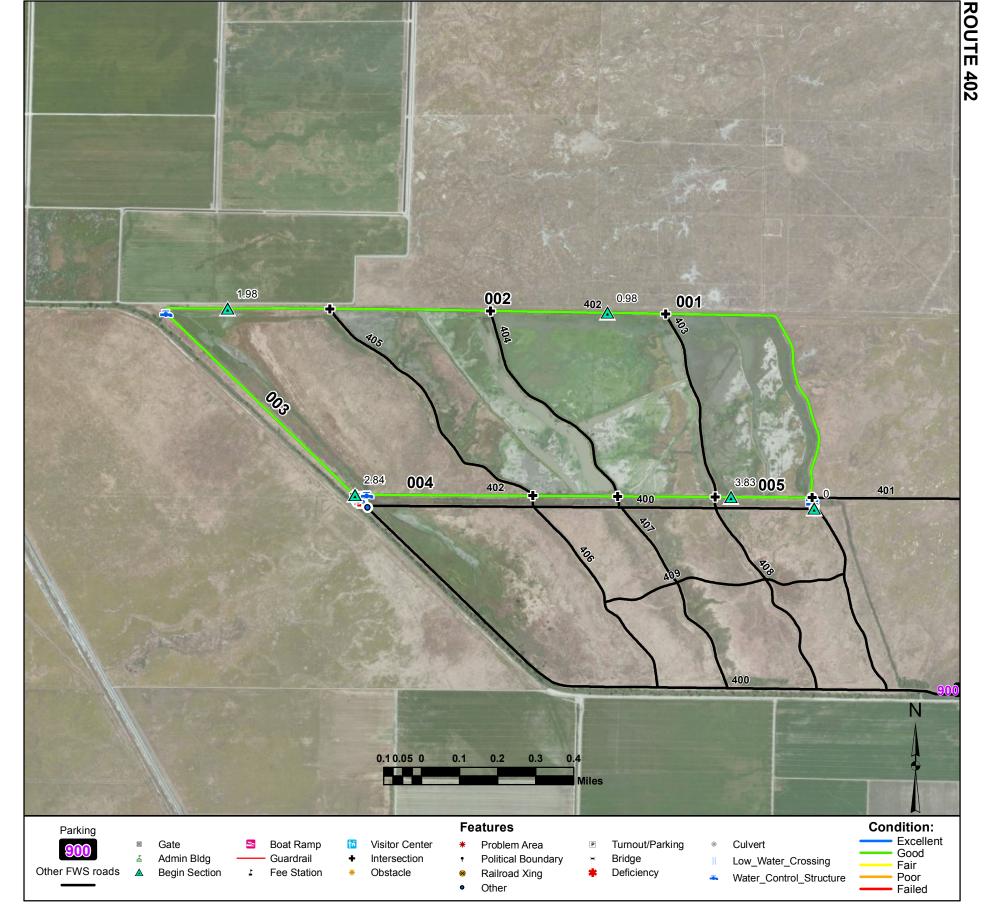


Wetland Units 1, 2, 3, 4 Boundary Road

From Wetland Units 6,7,8,9 Boundary Road (Route 400) around Wetland Units 1,2,3,4

Route Number: 402 Total Route Mileage: 4.09

Asset Number	-	-	-	-	-
Section Number	001	002	003	004	005
Section Length (miles)	0.98	1.00	0.91	0.99	0.21
Inspection Date	12-14-2011	12-14-2011	12-14-2011	12-14-2011	12-14-2011
Surface Type	Gravel	Gravel	Gravel	Gravel	Gravel
Number of Lanes	1	1	1	1	1
Roadway Width (feet)	12	12	12	12	12
Condition	Good	Good	Good	Good	Good
Remaining Service Life (years)	7	5	5	7	7
Estimated Cost to Repair	\$1,900	\$1,900	\$1,800	\$1,900	\$400
Current Replacement Value	\$809,200	\$828,100	\$755,100	\$820,000	\$177,100

Features	Mile Post	Features	Mile Post	Features	Mile Post	Features	Mile Post
Begin Section Other Water Control Structure	001-0.0 001-0.0 001-0.01	Begin Section Other Water Control Structure	004-2.84 004-2.84 004-2.87				
Intersection Water Control Structure Intersection Begin Section	001-0.03 001-0.03 001-0.81 002-0.98	Intersection Intersection Intersection Begin Section	004-3.31 004-3.53 004-3.79 005-3.83				
Intersection Intersection Begin Section	002-1.28 002-1.71 003-1.98	Other	005-4.04				
Water Control Structure Intersection DeficiencyCulvert Water Control Structure	003-2.16 003-2.84 003-2.86 003-2.86						
Other	003-2.89						

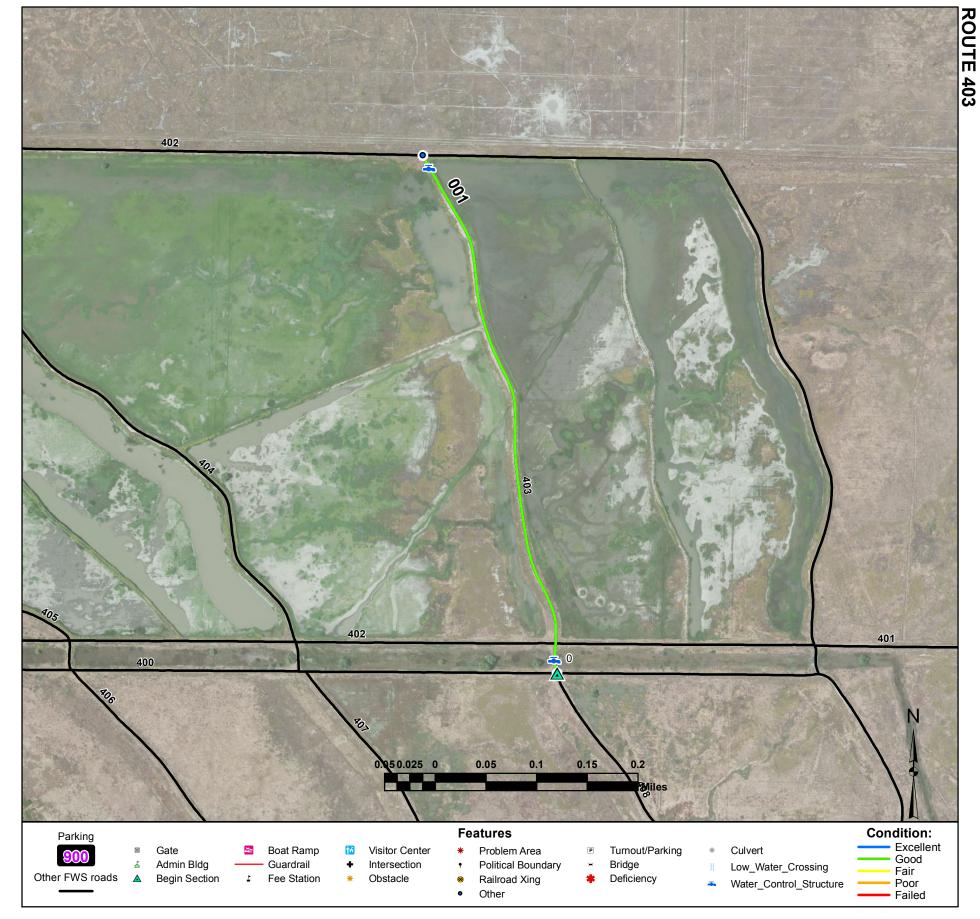


Wetland Units 3, 3A, 4 Cross Dike Road
From Wetland Units 6,7,8,9 Boundary Road (Route 400) to Wetland Units 1, 2, 3, 4 Boundary Road (Route 402)

Total Route Mileage: 0.54 Route Number: 403

			Ü
Asset Number	-		
Section Number	001		
Section Length (miles)	0.54		
Inspection Date	12-14-2011		
Surface Type	Gravel		
Number of Lanes	1		
Roadway Width (feet)	12		
Condition	Good		
Remaining Service Life (years)	7		
Estimated Cost to Repair	\$1,000		
Current Replacement Value	\$444,500		

Features	Mile Post	Features	Mile Post	Features	Mile Post	Features	Mile Post
Begin Section	001-0.0						
Other	001-0.0						
Water Control Structure	001-0.01						
Water Control Structure	001-0.52						
Other	001-0.54						
							1

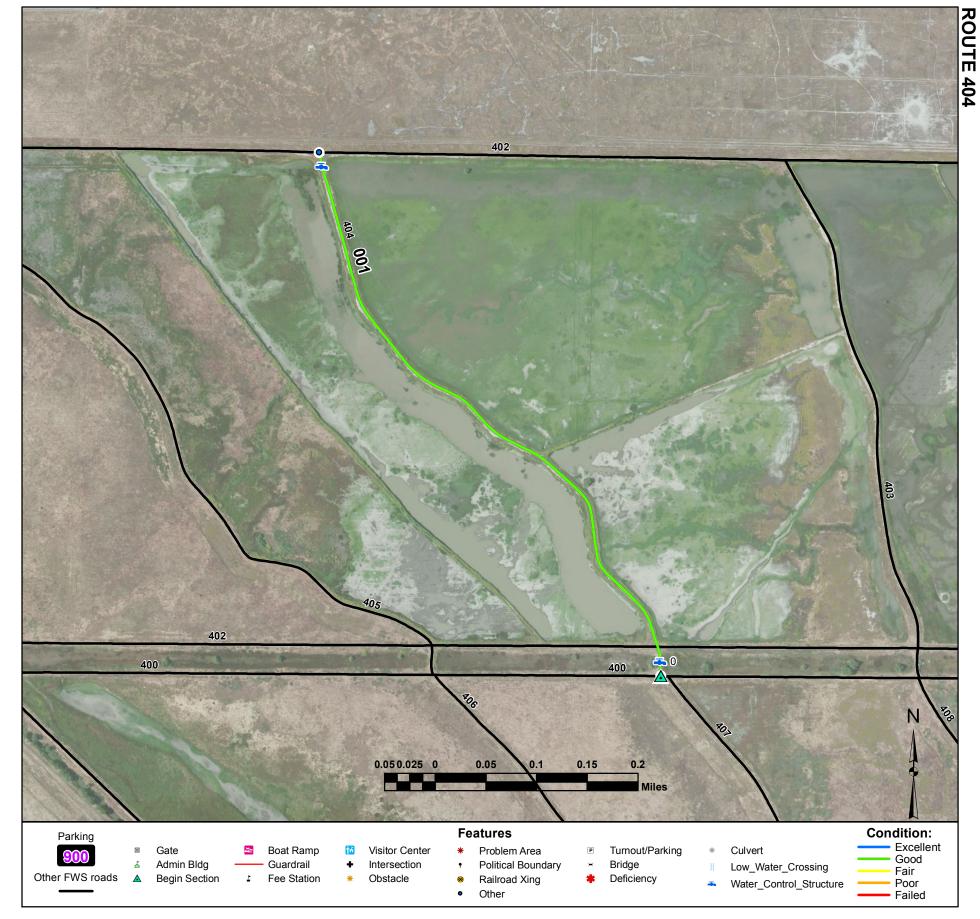


Wetland Units 2, 3, 3A Cross Dike Road
From Wetland Units 6,7,8,9 Boundary Road (Route 400) to Wetland Units 1, 2, 3, 4 Boundary Road (Route 402)

Total Route Mileage: 0.65 Route Number: 404

Asset Number	-
Section Number	001
Section Length (miles)	0.65
Inspection Date	12-14-2011
Surface Type	Gravel
Number of Lanes	1
Roadway Width (feet)	12
Condition	Good
Remaining Service Life (years)	5
Estimated Cost to Repair	\$1,300
Current Replacement Value	\$538,900

Features	Mile Post	Features	Mile Post	Features	Mile Post	Features	Mile Post
Begin Section	001-0.0						
Other	001-0.0						
Water Control Structure							
Water Control Structure							
Other	001-0.65						

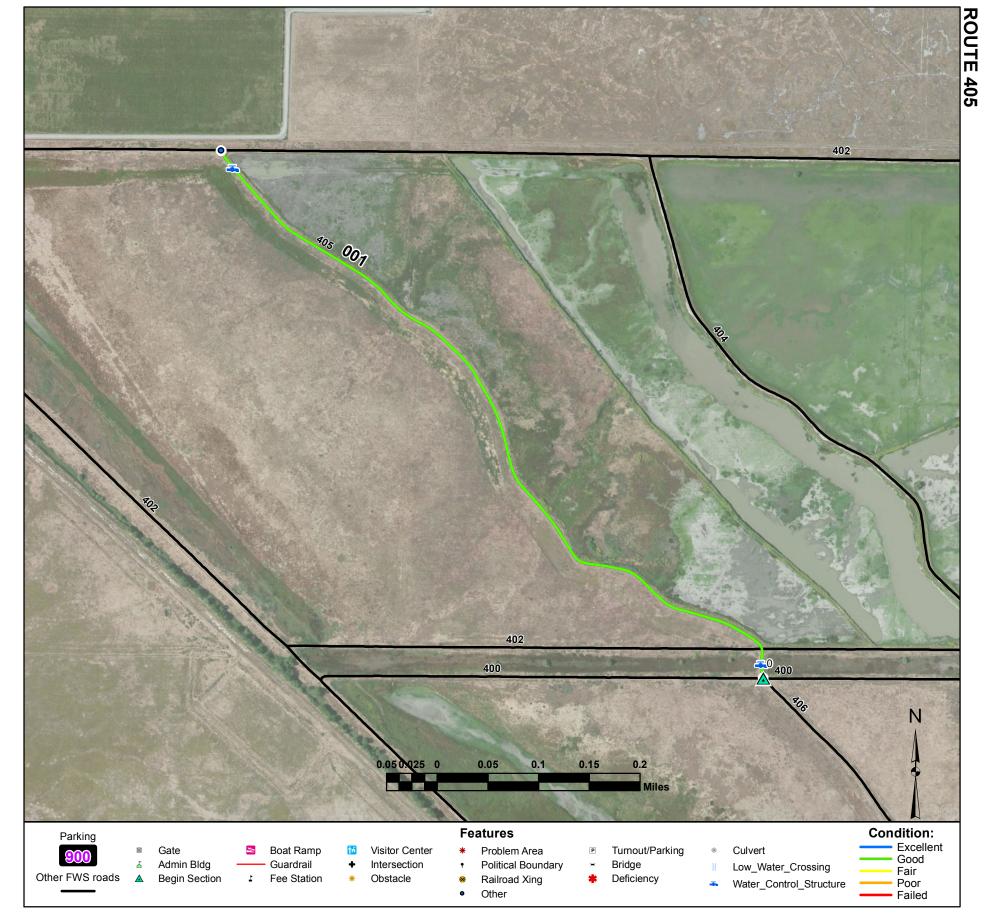


Wetland Units 1, 2A Cross Dike Road

From Wetland Units 6,7,8,9 Boundary Road (Route 400) to Wetland Units 1, 2, 3, 4 Boundary Road (Route 402)

Route Number: 405 Total Route Mileage: 0.79

Asset Number	-		
Section Number	001		
Section Length (miles)	0.79		
Inspection Date	12-14-2011		
Surface Type	Gravel		
Number of Lanes	1		
Roadway Width (feet)	12		
Condition	Good		
Remaining Service Life (years)	5		
Estimated Cost to Repair	\$1,500		
Current Replacement Value	\$651,600		

001-0.0 001-0.0 001-0.01				
			1	
001-0.01				
001-0.77				
001-0.79				
	01-0.77 01-0.79			

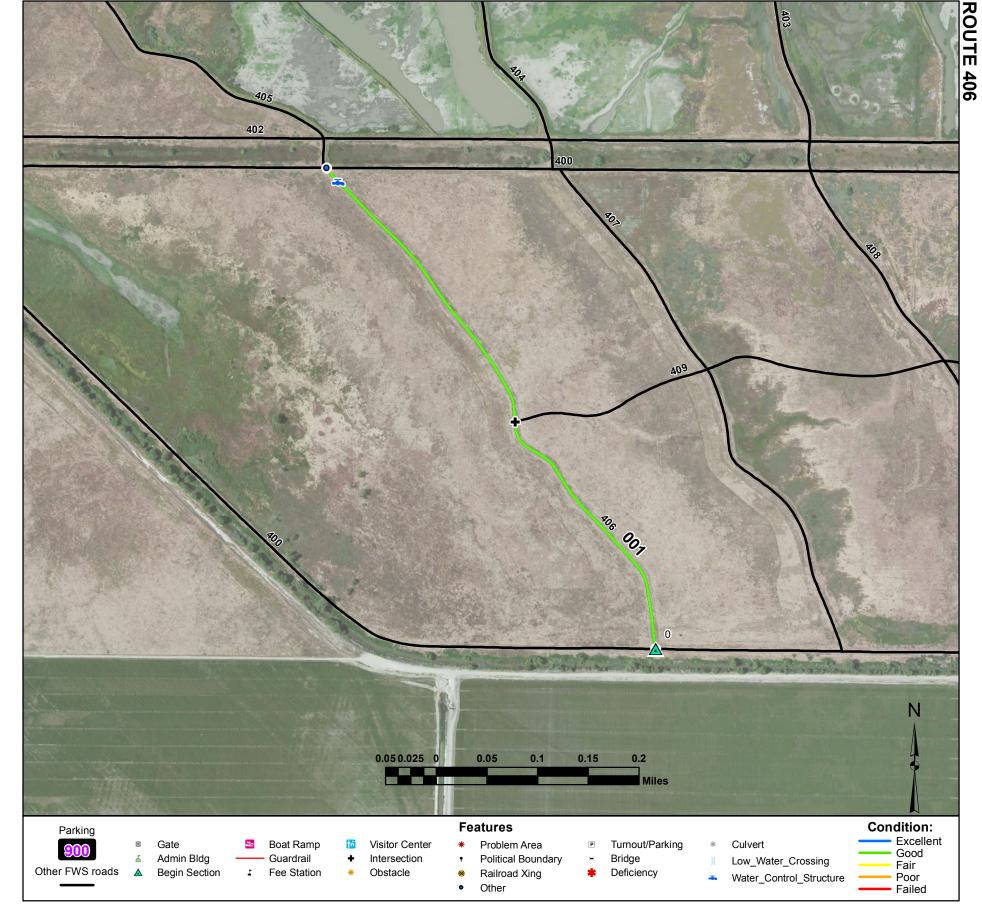


Wetland Units 6, 7 Cross Dike Road

From Wetland Units 6,7,8,9 Boundary Road (Route 400) to Wetland Units 6,7,8,9 Boundary Road (Route 400)

Route Number: 406 Total Route Mileage: 0.59

Asset Number	-		
Section Number	001		
Section Length (miles)	0.59		
Inspection Date	12-14-2011		
Surface Type	Gravel		
Number of Lanes	1		
Roadway Width (feet)	12		
ondition	Good		
emaining Service Life (years)	7		
stimated Cost to Repair	\$1,200		
Current Replacement Value	\$490,400		

Features	Mile Post	Features	Mile Post	Features	Mile Post	Features	Mile Post
Begin Section	001-0.0						
Other	001-0.0						
Intersection	001-0.27						
Water Control Structure	001-0.57						
Other	001-0.59						
				1	1		

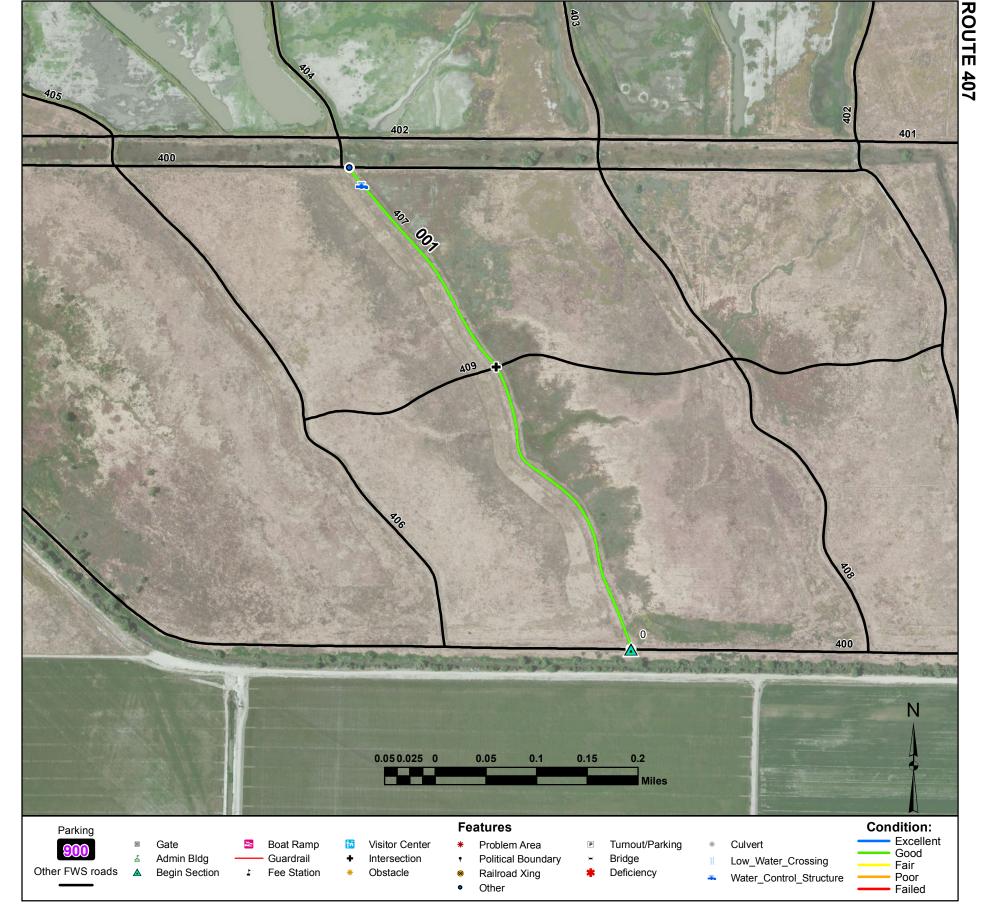


Wetland Units 7, 8 Cross Dike Road
From Wetland Units 6,7,8,9 Boundary Road (Route 400) to Wetland Units 6,7,8,9 Boundary Road (Route 400)

Total Route Mileage: 0.56 Route Number: 407

Asset Number	-		
Section Number	001		
Section Length (miles)	0.56		
Inspection Date	12-14-2011		
Surface Type	Gravel		
Number of Lanes	1		
Roadway Width (feet)	12		
Condition	Good		
Remaining Service Life (years)	5		
Estimated Cost to Repair	\$1,100		
Current Replacement Value	\$467,800		

Features	Mile Post	Features	Mile Post	Features	Mile Post	Features	Mile Post
Begin Section	001-0.0						
Other	001-0.0						
ntersection	001-0.31						
Water Control Structure	001-0.54						
Other	001-0.56						

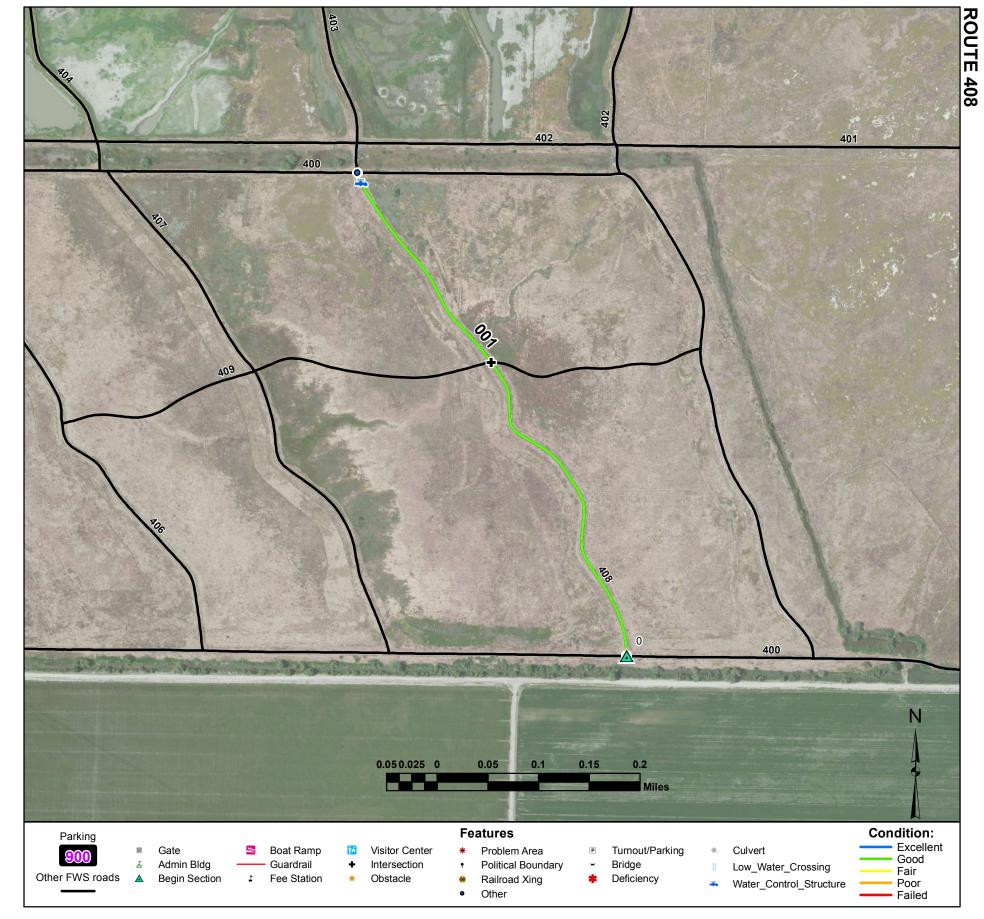


Wetland Units 8, 9 Cross Dike Road

From Wetland Units 6,7,8,9 Boundary Road (Route 400) to Wetland Units 6,7,8,9 Boundary Road (Route 400)

Route Number: 408 Total Route Mileage: 0.57

Asset Number	-
Section Number	001
Section Length (miles)	0.57
Inspection Date	12-14-2011
Surface Type	Gravel
Number of Lanes	1
Roadway Width (feet)	12
Condition	Good
Remaining Service Life (years)	7
Estimated Cost to Repair	\$1,100
Current Replacement Value	\$469,400

Features	Mile Post	Features	Mile Post	Features	Mile Post	Features	Mile Post
Begin Section	001-0.0						
Other	001-0.0						
Intersection	001-0.33						
Water Control Structure	001-0.56						
Other	001-0.57						

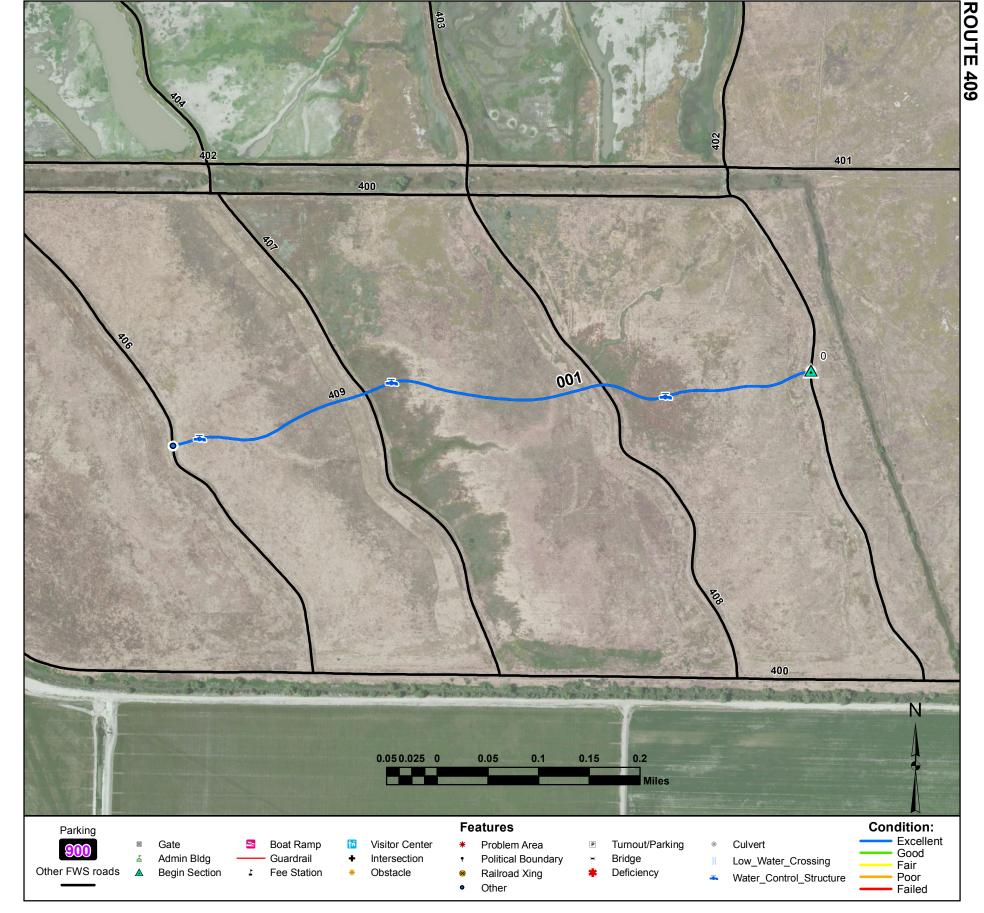

Wetland Units 7, 8, 9 Center Levee Road From Wetland Units 6,7,8,9 Boundary Road (Route 400) to Wetland Units 6, 7 Cross Dike Road (Route 406)

Trom Trolland Critic C,7,0,0 Boundary Road (Roads 100) to Trolland Critic C, 1 Cross Billio Road (Roads 100)

Route Number: 409 Total Route Mileage: 0.65

Asset Number	-		
Section Number	001		
Section Length (miles)	0.65		
nspection Date	12-14-2011		
_			
urface Type	Native		
Number of Lanes	1		
Roadway Width (feet)	12		
ndition	Excellent		
emaining Service Life (years)	8		
stimated Cost to Repair	\$0		
Current Replacement Value	\$280,000		

Features	Mile Post	Features	Mile Post	Features	Mile Post	Features	Mile Post
Begin Section	001-0.0						
Other	001-0.0						
Water Control Structure	001-0.15						
Water Control Structure	001-0.43						
Water Control Structure	001-0.62						
Other	001-0.65						

Route Number:900 Pixley Trailhead Parking


From Road 88


Asset Number	Area	Condition	Surface Type	Cost to Improve	Inspection Date	Current Replacement Value	
1000296	15683	Good	Gravel	\$2,800	12-14-2011	\$93,300	







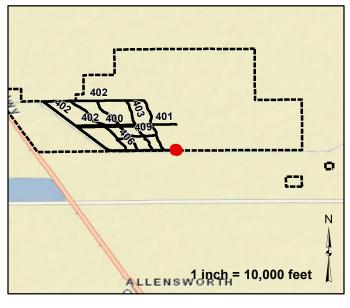

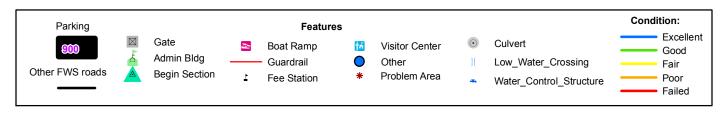

	Pixley Bridge Inventory							
Rte#	Milepost	NBIS#	Sufficiency Rating	Functionally Obsolete	Structurally Deficient			
No Bridges to	report							

ROUTE: 400 Features Photographs



Photo: PIXL_C4_0478 Route: 400-001-0.0 Begin Section



Photo: PIXL_C4_0477 Route: 400-001-0.0 Metal Cable Gate Asset# NA



Photo: PIXL_C4_0479 Route: 400-001-0.08 Metal WCS Screw Gate 50ft long 48in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0480 Route: 400-001-0.08 Metal WCS Screw Gate 50ft long 48in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0481 Route: 400-002-1.06 Begin Section



Photo: PIXL_C4_0482 Route: 400-002-1.79

Metal WCS Flashboard Riser 40ft long 48in dia. 3ft deep
Asset# NA 8-001

ROUTE: 400 Features Photographs



Photo: PIXL_C4_0483 Route: 400-002-1.79 Metal WCS Flashboard Riser 40ft long 48in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0484 Route: 400-003-2.02 Begin Section



Photo: PIXL_C4_0485 Route: 400-003-2.21 Metal WCS Flashboard Riser 40ft long 36in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0486 Route: 400-003-2.21 Metal WCS Flashboard Riser 40ft long 36in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0487 Route: 400-003-2.44 Metal WCS Flashboard Riser 40ft long 36in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0488 Route: 400-003-2.44

Metal WCS Flashboard Riser 40ft long 36in dia. 3ft deep
Asset# NA 8-002

ROUTE: 400 Features Photographs



Photo: PIXL_C4_0489 Route: 400-003-2.7 Metal WCS Flashboard Riser 40ft long 36in dia. 4ft deep Asset# NA



Photo: PIXL_C4_0490 Route: 400-003-2.7 Metal WCS Flashboard Riser 40ft long 36in dia. 4ft deep Asset# NA



Photo: PIXL_C4_0491 Route: 400-004-3.19 Begin Section



Photo: PIXL_C4_0492 Route: 400-004-3.43 Metal Culvert 30ft long 24in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0493 Route: 400-004-3.43 Metal Culvert 30ft long 24in dia. 3ft deep Asset# NA

ROUTE: 401 Features Photographs



Photo: PIXL_C4_0494 Route: 401-001-0.0 Begin Section



Photo: PIXL_C4_0495 Route: 401-001-0.0 Metal Open Rail Gate Asset# NA

ROUTE: 402 Features Photographs



Photo: PIXL_C4_0496 Route: 402-001-0.0 Begin Section



Photo: PIXL_C4_0497 Route: 402-001-0.01 Metal WCS Flashboard Riser 40ft long 48in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0498 Route: 402-001-0.01 Metal WCS Flashboard Riser 40ft long 48in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0499 Route: 402-001-0.03 Metal WCS Screw Gate 50ft long 24in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0500 Route: 402-001-0.03 Metal WCS Screw Gate 50ft long 24in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0501 Route: 402-002-0.98 Begin Section

ROUTE: 402 Features Photographs



Photo: PIXL_C4_0502 Route: 402-003-1.98 Begin Section



Photo: PIXL_C4_0503 Route: 402-003-2.16 Metal WCS Flashboard Riser 40ft long 36in dia. 5ft deep Asset# NA



Photo: PIXL_C4_0504 Route: 402-003-2.16 Metal WCS Flashboard Riser 40ft long 36in dia. 5ft deep Asset# NA



Photo: PIXL_C4_0507 Route: 402-003-2.86 Deficiency Culvert Further Investigation Required Culvert Washing out Asset# NA



Photo: PIXL_C4_0505 Route: 402-003-2.86 Plastic WCS Flashboard Riser 70ft long 48in dia. 5ft deep Asset# NA



Photo: PIXL_C4_0506 Route: 402-003-2.86 Plastic WCS Flashboard Riser 70ft long 48in dia. 5ft deep Asset# NA 8-006

ROUTE: 402 Features Photographs



Photo: PIXL_C4_0508 Route: 402-004-2.84 Begin Section



Photo: PIXL_C4_0509 Route: 402-004-2.87 Metal WCS Flashboard Riser 40ft long 36in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0510 Route: 402-004-2.87 Metal WCS Flashboard Riser 40ft long 36in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0511 Route: 402-005-3.83 Begin Section

ROUTE: 403 Features Photographs



Photo: PIXL_C4_0512 Route: 403-001-0.0 Begin Section



Photo: PIXL_C4_0515 Route: 403-001-0.01 Plastic WCS Flashboard Riser 40ft long 48in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0517 Route: 403-001-0.52 Plastic WCS Flashboard Riser 25ft long 24in dia. 2ft deep Asset# NA



Photo: PIXL_C4_0513 Route: 403-001-0.01 Plastic WCS Flashboard Riser 40ft long 48in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0516 Route: 403-001-0.52 Plastic WCS Flashboard Riser 25ft long 24in dia. 2ft deep Asset# NA

ROUTE: 404 Features Photographs



Photo: PIXL_C4_0522 Route: 404-001-0.0 Begin Section



Photo: PIXL_C4_0521 Route: 404-001-0.01 Plastic WCS Flashboard Riser 50ft long 48in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0519 Route: 404-001-0.64 Plastic WCS Flashboard Riser 25ft long 24in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0520 Route: 404-001-0.01 Plastic WCS Flashboard Riser 50ft long 48in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0518 Route: 404-001-0.64 Plastic WCS Flashboard Riser 25ft long 24in dia. 3ft deep Asset# NA

ROUTE: 405 Features Photographs



Photo: PIXL_C4_0523 Route: 405-001-0.0 Begin Section



Photo: PIXL_C4_0524 Route: 405-001-0.01 Plastic WCS Flashboard Riser 40ft long 48in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0525 Route: 405-001-0.01 Plastic WCS Flashboard Riser 40ft long 48in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0526 Route: 405-001-0.77 Metal WCS Screw Gate 50ft long 24in dia. 2ft deep Asset# NA



Photo: PIXL_C4_0527 Route: 405-001-0.77 Metal WCS Screw Gate 50ft long 24in dia. 2ft deep Asset# NA

ROUTE: 406 Features Photographs



Photo: PIXL_C4_0530 Route: 406-001-0.0 Begin Section



Photo: PIXL_C4_0528 Route: 406-001-0.57 Plastic WCS Flashboard Riser 50ft long 24in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0529 Route: 406-001-0.57 Plastic WCS Flashboard Riser 50ft long 24in dia. 3ft deep Asset# NA

ROUTE: 407 Features Photographs



Photo: PIXL_C4_0531 Route: 407-001-0.0 Begin Section



Photo: PIXL_C4_0532 Route: 407-001-0.54 Plastic WCS Flashboard Riser 40ft long 24in dia. 3ft deep Asset# NA



Photo: PIXL_C4_0533 Route: 407-001-0.54 Plastic WCS Flashboard Riser 40ft long 24in dia. 3ft deep Asset# NA

ROUTE: 408 Features Photographs



Photo: PIXL_C4_0536 Route: 408-001-0.0 Begin Section



Photo: PIXL_C4_0534 Route: 408-001-0.56 Plastic WCS Flashboard Riser 30ft long 24in dia. 4ft deep Asset# NA



Photo: PIXL_C4_0535 Route: 408-001-0.56 Plastic WCS Flashboard Riser 30ft long 24in dia. 4ft deep Asset# NA

ROUTE: 409 Features Photographs



Photo: PIXL_C4_0537 Route: 409-001-0.0 Begin Section



Photo: PIXL_C4_0538 Route: 409-001-0.15 Plastic WCS Flashboard Riser 30ft long 24in dia. 2ft deep Asset# NA



Photo: PIXL_C4_0539 Route: 409-001-0.15 Plastic WCS Flashboard Riser 30ft long 24in dia. 2ft deep Asset# NA



Photo: PIXL_C4_0540 Route: 409-001-0.43 Plastic WCS Flashboard Riser 30ft long 24in dia. 2ft deep Asset# NA



Photo: PIXL_C4_0541 Route: 409-001-0.43 Plastic WCS Flashboard Riser 30ft long 24in dia. 2ft deep Asset# NA



Photo: PIXL_C4_0542 Route: 409-001-0.62 Plastic WCS Flashboard Riser 30ft long 24in dia. 2ft deep Asset# NA 8-014

ROUTE: 409 Features Photographs



Photo: PIXL_C4_0543 Route: 409-001-0.62
Plastic WCS Flashboard Riser 30ft long 24in dia. 2ft deep Asset# NA

Accident Summary

Number of Accidents Reported	Timespan of Accidents	Injuries	Fatalities
0	No Accidents to Report	0	0

APPENDIX

TA	BLE 1 - GENERAL FWS ROAD FUNCTIONAL CLASSIFICATION
Class I	Principal Refuge Road (Public Roads) - Routes that constitute the main access
	route, main auto tour route, or thoroughfare for refuge visitors. These routes are
	accessible by 2WD vehicles. Routes are numbered from 10 to 99.
Class II	Connector Refuge Road (Public Roads) - Routes that provide circulation within
	the refuge. These routes can also provide access to areas of scenic, scientific,
	recreational or cultural interest, such as overlooks, campgrounds, education
	centers, etc. These routes are accessible by 2WD vehicles. Routes are numbered
	from 100 to 199.
Class III	Special Purpose Refuge Road (Public Roads) - Roads that provide circulation
	within special use areas such as campgrounds or public concessionaire facilities
	or access to remote areas of the refuge. These routes may not be 2WD accessible.
	Routes are numbered from 200 to 299
Class IV	Administrative Access Road (Administrative Roads) - Routes intended for access
	to administrative developments or structures such as maintenance offices,
	employee quarters, or utility areas. These routes are accessible by 2WD vehicles.
	These routes may restrict access to the general public. Routes are numbered from
	300 to 399.
Class V	Restricted Road (Administrative Roads) - Routes normally closed to the public,
	such as maintenance roads, service roads, patrol roads, and fire breaks. These
	routes may be open to the public for a short period of time for a special use, such
	as hunting access. These routes may not be 2WD accessible. Routes are
	numbered from 400 to 499.

A refuge road system contains those routes within or giving access to a refuge or other unit of the FWS that are administered by the FWS, or by the Service in cooperation with other agencies. The assignment of a functional classification (FC) to a refuge road is not based on traffic volumes or design speed, but on the intended use or function of that route

DESCRIPTION OF RATING SYSTEM

Rating Data is collected on four different surface types: Asphalt, Concrete, Gravel, and Native. The Utah LTAP Center's Remaining Service Life (RSL) system is used for all surface types. The RSL system is based on the Strategic Highway Research Program's (SHRP) Distress Identification Manual.

Asphalt Rating System

Data is collected on the following distresses and conditions:

- **Fatigue Cracking** Interconnected cracks forming small irregular shapes.
- **Longitudinal Cracking** Cracks running parallel with the roadway, in the direction of traffic.
- **Transverse Cracking** Cracks perpendicular to the roadway, going across the lane or lanes.
- **Block Cracking** Interconnected cracks forming large blocks.
- **Edge Cracking** Cracks running along the edge of the pavement surface.
- **Patches** Original surface repaired with new asphalt patch material.
- **Potholes** Holes or depressions in the pavement.
- **Rutting** surface depressions in the wheel paths.
- **Roughness** Evenness of pavement for serviceability.
- **Drainage** Ability of the road surface to drain water based on proper slope.

A Condition Rating value is calculated for each homogenous pavement section, and can be up to 1 mile in length.

Rating Index Formula

Fatigue, longitudinal, transverse, block, and edge cracking, along with patching and potholes are rated on a 0 - 9 scale (0 = no distress, 9 = maximum distress). The rating given is based on the extent and the severity of the distress. Rutting, roughness, and drainage are rated on a 0 - 3 scale (0 = excellent, 3 = poor). Each distress type has given Remaining Service Life (RSL) values (in years) based on the rating for that particular distress. The distress with the rating resulting in the lowest RSL value is considered to be the governing distress. That value is then assigned as the RSL of the road segment.

Concrete Rating System

Data is collected on the following distresses and conditions:

- **Spalling of Joints** Chipping, breaking, or cracking of slab edges
- **Joint Seal Damage** Any damage or condition that enables materials or water to infiltrate into the joint from the surface.
- **Corner Breaks** A portion of the slab separated by a crack that intersects the adjacent transverse and longitudinal joints, forming approximately a 45° angle to the direction.
- **Broken Slabs** Faulting and/or cracking localized to individual slabs.

- **Faulting** Difference in elevation across a crack or joint.
- **Longitudinal Cracking** Cracks in the pavement running parallel to road.
- **Transverse Cracking** Cracks in the pavement running perpendicular to the direction of traffic.
- **Patch Deterioration** Faulting, settling, or cracking of previously placed patch
- Map Cracking A series of cracks that extend only into the upper surface of the Slab

A Condition Rating value is calculated for each homogenous pavement section, and can be up to 1 mile in length.

Rating Index Formula

The rating procedure for concrete pavement is the same as that for asphalt pavement described previously. Each of the distresses described above are rated on the same 0-9 scale. The governing distress is then determined and the RSL associated with that distress is assigned to the road segment.

Gravel and Native Rating System

Data is collected on the following distresses and conditions:

- **Cross Section (Crown)** Roadway built so that the center is higher than the shoulder, to prevent water from pooling on roadway.
- **Roadside Drainage** Roadside ditches and culverts to handle water flow and prevent pooling on the roadside.
- **Corrugations (Washboarding)** Small trenches or holes developing perpendicular to the roadway.
- **Potholes** Holes or depressions in the roadway.
- **Rutting** Depressions running parallel with the roadway, in the wheelpaths.
- **Dust** Amount of dust caused by traffic.
- **Loose Aggregate (Gravel Only)** Loose gravel, typically piled up on the roadway edges or centerline.

A Condition Rating value is calculated for each homogenous pavement section, and can be up to 1 mile in length.

Rating Index Formula

The rating procedure for unpaved roads is the same as that for asphalt and concrete pavements described previously. Of the distresses described above, corrugations, potholes, rutting, and loose aggregate are rated on the same 0-9 scale previously mentioned. Cross section, roadside drainage, and dust are rated on the same 0-3 scale described for asphalt pavement. The governing distress is then determined and the RSL associated with that distress is assigned to the road segment.

Condition Descriptions by Surface Type

The following definitions are used to describe pavement condition for the various surface types. These are general guidelines for condition indications.

Asphalt

Excellent – Recently constructed or overlaid road where construction or overlay was performed correctly- No maintenance required. RSL = 19-20 years.

Good – Low extent longitudinal and transverse cracks. All cracks are 1/4" or less with little or no crack erosion. Patches are in good condition and applied correctly. Routine Maintenance recommended. RSL = 13-18 years.

Fair - Roads are in good structural condition with little or no fatigue cracking. Longitudinal, transverse, and edge cracking is at medium extent and severity. Block cracking is not extensive. Any patches are in good condition. Preventative maintenance recommended. RSL = 7-12 years.

Poor - Road beginning to show signs of structural distress. Fatigue cracking is medium to high extent and medium severity. Cracking will be severe. Surface may have severe block cracking and show. Patches are in fair to poor condition. There is moderate distortion or rutting and occasional potholes. Rehabilitation recommended. RSL = 1-6 years.

Failed - Road is severely deteriorated. Signs of structural failure appear along with severe and extensive fatigue cracking, distortion, potholes, or extensive patches in poor condition. Reconstruction recommended. RSL = 0 years.

Concrete

Excellent - New pavement. No maintenance required. RSL = 19-20 years

Good - First signs of transverse cracking, patch or repair, more extensive pop-outs, or scaling. Sealing or routine maintenance recommended. RSL = 13-18 years.

Fair – Pavement has join or crack spalling, and/or faulting, along with cracking at corners with broken pieces. Any Patches are in fair condition and faulting is at a minimum. Preventative maintenance recommended. RSL = 7-12 years.

Poor - Joints and cracks are open 1 inch, spalled, or patched. Faulting is more severe. Rehabilitation recommended. RSL = 1-6 years.

Failed - Most slabs have failed structurally, and faulting is severe. Reconstruction recommended. RSL = 0 years.11-9

The following table shows the relationship between RSL and condition.

S	SUBJECTIVE CONDITION RATING FOR REMAINING SERVICE LIFE							
	(Asphalt and Concrete Pavements)							
	FAILED	PO	OR	FAIR		GOOD		EXCELLENT
RSL Years	0	1-3	4-6	7-9	10-12	13-15	16-18	19-20

Gravel and Native

Note - Native surfaces do not have a gravel layer.

Excellent - Newly constructed road that has been constructed properly with proper crown, drainage and gravel layer. Little or no distress. No maintenance recommended. RSL = 8-10 years.

Good - Crown, drainage provisions, and gravel layer are in good condition. Distress limited to traffic effects such as dust, loose aggregate, and low severity corrugations (wash boarding). RSL = 5-7 years.

Fair - Adequate drainage and crown through majority of roadway. Crown repair, ditch improvement may be necessary. Road has more severe corrugations and potholes. Preventative maintenance recommended. RSL = 3-4 years.

Poor - Travel at slow speeds is necessary. Additional gravel layer needed to carry traffic. Poor crown. Ditching is inadequate and rutting is extensive and severe. Rehabilitation recommended. RSL = 1-2 years.

Failed - Travel is difficult, and road may be closed at times. Rutting and Corrugations are very severe. Total Reconstruction of road is recommended. RSL = 0 years.

The following table shows the RSL values for gravel and native roads in terms of excellent, good, fair, poor, and failed condition.

SUI	SUBJECTIVE CONDITION RATING FOR REMAINING SERVICE LIFE							
	(Gravel and Native Surfaces)							
	FAILED	POOR	FAIR	GOOD	EXCELLENT			
RSL Years								

NATIVE PRIMITIVE/IMPROVED RATING SHEET

	Cross Section (Crown)*						
	Condition		Description				
	No Defects	0	Crown 4-6" with no restriction of water flow from centerline to ditch.				
Severity	Minor Defects	1	Inadequate or inconsistent crown. Drainage to ditch may be restricted.				
Seve	Moderate Defects 2		Flat crown, drainage to ditch restricted.				
	Major Defects 3		Reverse crown, bowl-shaped road, drainage on roadway				

	<u>Rutting</u>							
l .	Extent (Length)							
	No Defects	Low <10%	Med 10-30%	High >30%				
_	Low < 6"	1	2	3				
Severity	Med 6-12"	4	5	6				
S	High > 12"	7	8	9				

	Roadside Drainage*						
	Condition		Description				
	No Defects	0	Wide, deep ditches (>4') with no restriction to water flow.				
rity	Minor Defects 1		Adequate ditches (>2' deep), minor obstructions restrict water flow.				
Severity	Moderate Defects 2		Shallow, narrow and obstructed ditches. Minor erosion of road.				
	Major Defects	3	No ditch, drainage on roadway with moderate to severe erosion.				

	<u>Potholes</u>							
	Extent (Area)							
	No Defects	Low <10%	Med 10-30%	High >30%				
>	Low < 6"	1	2	3				
Severity	Med 6-12"	4	5	6				
S	High > 12"	7	8	9				

	<u>Dust</u>					
	Condition		Description			
	No Defects	0	No obstruction to sight distance.			
Severity	Minor Defects 1		Sight distance > 550'			
Seve	Moderate Defects	2	Sight distance 225'-550'			
	Major Defects	3	Sight distance < 225'			

	Corrugations							
	Extent (Length)							
	No Defects	Low <10%	Med 10-30%	High >30%				
>	Low < 3"	1	2	3				
Severity	Med 3-6"	4	5	6				
S	High > 6"	7	8	9				

^{*} Crown and Drainage are not rated for roads that have no constructed crown or drainage. This applies to Native and Gravel roads.

GRAVEL RATING SHEET

	Cross Section (Crown)						
	Condition		Description				
	No Defects	0	Crown 4-6" with no restriction of water flow from centerline to ditch.				
Severity	Minor Defects	1	Inadequate or inconsistent crown. Drainage to ditch may be restricted.				
Seve	Moderate Defects 2		Flat crown, drainage to ditch restricted.				
	Major Defects 3		Reverse crown, bowl-shaped road, drainage on roadway				

	Rutting						
	Extent (Length)						
	No Defects	Low <10%	Med 10-30%	High >30%			
	Low < 1"	1	2	3			
Severity	Med 1-3"	4	5	6			
S	High > 3"	7	8	9			

	Roadside Drainage			
	Condition		Description	
Severity	No Defects	0	Wide, deep ditches (>4') with no restriction to water flow.	
	Minor Defects	1	Adequate ditches (>2' deep), minor obstructions restrict water flow.	
	Moderate Defects	2	Shallow, narrow and obstructed ditches. Minor erosion of road.	
	Major Defects	3	No ditch, drainage on roadway with moderate to severe erosion.	

		Potho	oles	
		Ex	ctent (Are	ea)
	No Defects	Low <10%	Med 10-30%	High >30%
>	Low < 1"	1	2	3
Severity	Med 1-3"	4	5	6
S	High > 3"	7	8	9

	<u>Dust</u>			
	Condition		Description	
	No Defects	0	No obstruction to sight distance.	
Severity	Minor Defects	1	Sight distance > 550'	
Sev	Moderate Defects	2	Sight distance 225'-550'	
	Major Defects	3	Sight distance < 225'	

<u>Corrugations</u>				
		Ext	ent (Len	gth)
	No Defects	Low <10%	Med 10-30%	High >30%
^	Low < 2"	1	2	3
Severity	Med 2-4"	4	5	6
S	High > 4"	7	8	9

^{*} Crown and Drainage are not rated for roads that have no constructed crown or drainage. This applies to Native and Gravel roads.

Loose Aggregate					
	Extent (Area)				
	No Defects	Low <10%	Med 10-30%	High >30%	
_	Low < 1"	1	2	3	
Severity	Med 1-3"	4	5	6	
S	High > 3"	7	8	9	

ASPHALT RATING SHEET

	Fatigue Cracking				
	No Defects	Low 1 crack WP	Extent Med 2 cracks WP	High >30% lenath	
_	Low-Cracks < 1/4"	1	2	3	
Severity	Med-Cracks 1/4-3/4"	4	5	6	
S	High-Cracks > 3/4"	7	8	9	

	Edge Cracking			
		Ext	t ent (Leng	gth)
	No Defects	Low <10%	Med 10-30%	High >30%
_	0-6" from curb	1	2	3
Severity	6-18" from curb	4	5	6
S	> 18" from curb	7	8	9

	Longitudinal Cracking				
	Extent				
	No Defects	Low 1 crack full length	Med 2 cracks full length	High >2 cracks full length	
>	Low-Cracks < 1/4"	1	2	3	
Severity	Med-Cracks 1/4-3/4"	4	5	6	
S	High-Cracks > 3/4"	7	8	9	

	Block Cracking				
	Extent (Length)				
	No Defects	Low > 15x15' squares	Med 15-10' squares	High <10x10' squares	
_	Low-Cracks < 1/4"	1	2	3	
Severity	Med-Cracks 1/4-3/4"	4	5	6	
S	High-Cracks > 3/4"	7	8	9	

	Transverse Cracking			
		Extent (ft betweer	n cracks)
	No Defects	Low > 200'	Med 200-50'	High < 50'
_	Low-Cracks < 1/4"	1	2	3
Severity	Med-Cracks 1/4-3/4"	4	5	6
S	High-Cracks > 3/4"	7	8	9

		<u>Utility</u>	Cuts	
		Ext	t ent (Lenç	gth)
	No Defects	Low <10%	Med 10-30%	High >30%
_	Low-Cracks < 1/4"	1	2	3
Severity	Med-Cracks 1/4-3/4"	4	5	6
S	High-Cracks > 3/4"	7	8	9

	<u>Drainage/Roughness/Rutting</u>			
	Condition		Description	
	No Defects	0	Wide, deep ditches with no obstructions, smooth ride, no rutting, no potholes.	
ərity	Minor Defects	1	Drainage may be obstructed, < 1" rutting, minor roughness.	
Seve	Moderate Defects	2	Poor drainage, 1-2" rutting, noticeable roughness, potholes < 6" wide.	
	Major Defects	3	No drainage; > 2" rutting; potholes 6-12" wide create roughness requiring reduced speeds.	

CONCRETE RATING SHEET

Spalling of Joints

Extent (% joints)

	No Defects	Low <10%	Med 10-20%	High >20%
	Low Spalls < 3"	1	2	3
Severity	Med Spalls 3-6"	4	5	6
	High Spalls > 6"	7	8	9

Broken Slabs

Extent (% slabs)

	No Defects	Low <5%	Med 5-15%	High >15%
	Low-no more than 3 pieces, no spalling/faulting	1	2	3
Severity	Med-broken into >3 pieces, spalling/faulting <1/4"	4	5	6
	High-4 or more pieces, spalling/faulting >1/4"	7	8	9

Transverse Cracks

Extent (% slabs)

		Exterit (70 Slaus)				
	No Defects	Low <10%	Med 10-20%	High >20%		
	Low-Cracks < 1/8"; no spalling/faulting	1	2	3		
Severity	Med-Cracks 1/8- 1/2"; spall <3", fault >1/4"	4	5	6		
	High-Cracks > 1/2"; spall >3", fault >1/4"	7	8	9		

Joint Seal Damage

Extent (%joints)

	Exterit (70joints)				
No Defects	Low <10%	Med 10-20%	High >20%		
Low <10% joint length	1	2	3		
Med 10-50% joint length	4	5	6		
High >50% joint length	7	8	9		

<u>Faulting</u>

Extent (Length)

	No Defects	Low <10%	Med 10-30%	High >30%
	Low < 1/2"	1	2	3
Severity	Med 1/2-1"	4	5	6
	High > 1"	7	8	9

Patch Deterioration

Extent (Area)

		Exterit (Alea)				
	No Defects	Low <10%	Med 10-30%	High >30%		
	Low-no fault, no settle at perimeter	1	2	3		
Severity	Med-fault & settle <1/4" at perimeter	4	5	6		
	High-fault & settle >1/4" at perimeter, cracked patch	7	8	9		

Corner Breaks

Extent (% of slabs)

		Extorit (70 or olabo				
	No Defects	Low <10%	Med 10-20%	High >20%		
	Low-corner cracks, no spalling or faulting	1	2	3		
Severity	Med-crack slightly spalled & faulted <1/4"	4	5	6		
	High-crack highly spalled & faulted >1/4"	7	8	9		

Longitudinal Cracks

Extent (% slabs)

	No Defects	Low <10%	Med 10-20%	High >20%
٠	Low-Cracks < 1/8"; no spalling/faulting	1	2	3
Severity	Med-Cracks 1/8- 1/2"; spall <3", fault >1/2"	4	5	6
	High-Cracks > 1/2"; spall >3", fault >1/2"	7	8	9

Map Cracks

Extent (Area)

		Extent (Alea)				
	No Defects	cts				
	Low-small connected cracks, no spalling	1	2	3		
Severity	Med-connected cracks, no spalling	4	5	6		
	High-large connected cracks with surface spalling	7	8	9		

Deficiency Ratings With Associated Remaining Service Life

Asphalt Rating Sheet

Fatigue Cracking		Edge Cracking	
Distress Rating	Remaining Service Life	Distress Rating	Remaining Service Life
0	20	0	20
1	10	1	12
2	8	2	10
3	6	3	8
4	8	4	10
5	6	5	8
6	4	6	6
7	6	7	8
8	2	8	6
9	0	9	4

Transverse Cracking		Utilit	y Cuts
Distress Rating	Remaining Service Life	Distress Rating	Remaining Service Life
0	20	0	20
1	14	1	14
2	12	2	12
3	10	3	10
4	12	4	12
5	10	5	10
6	8	6	8
7	10	7	10
8	6	8	6
9	2	9	2

Longitudinal Cracking		Block Cracking	
Distress Rating	Remaining Service Life	Distress Rating	Remaining Service Life
0	20	0	20
1	14	1	12
2	12	2	10
3	10	3	8
4	12	4	10
5	10	5	8
6	8	6	6
7	10	7	12
8	8	8	6
9	6	9	2

Drainage/Roughness/R utting			
Distress Rating	Remaining Service Life		
0	20		
1	16		
2	10		
3	4		

Concrete Rating Sheet

Spa	alling	Broke	Broken Slabs		se Cracks
Distress Rating	Remaining Service Life	Distress Rating	Remaining Service Life	Distress Rating	Remaining Service Life
0	20	0	20	0	20
1	15	1	15	1	18
2	12	2	12	2	15
3	10	3	10	3	12
4	12	4	12	4	15
5	10	5	10	5	10
6	8	6	8	6	6
7	10	7	10	7	10
8	6	8	6	8	4
9	0	9	0	9	0

Joint Se	al Damage	Faulting		Patch De	terioration
Distress Rating	Remaining Service Life	Distress Rating	Remaining Service Life	Distress Rating	Remaining Service Life
0	20	0	20	0	18
1	16	1	15	1	16
2	14	2	12	2	14
3	12	3	10	3	12
4	14	4	12	4	12
5	10	5	8	5	10
6	8	6	6	6	8
7	12	7	10	7	10
8	8	8	4	8	6
9	6	9	0	9	0

Corne	r Breaks	Longitudinal Cracks		Мар	Cracks
Distress Rating	Remaining Service Life	Distress Rating	Remaining Service Life	Distress Rating	Remaining Service Life
0	18	0	20	0	20
1	16	1	18	1	18
2	14	2	15	2	15
3	12	3	12	3	12
4	12	4	15	4	12
5	10	5	10	5	10
6	8	6	6	6	6
7	10	7	10	7	10
8	6	8	4	8	4
9	0	9	0	9	0

SUBJECTIVE CONDITION RATING FOR REMAINING SERVICE LIFE IN YEARS (Asphalt & Concrete Roads)

	FAILED	POOR	FAIR	GOOD	EXCELLENT
RSL	0	1 - 6	7 - 12	13 - 18	19 - 20

Deficiency Ratings With Associated Remaining Service Life

Native Primitive Improved Rating Sheet

4

Remaining

Service

Life

10

8

Dust

Distress

Rating

0

1

Cross	Section	Ru	ıtting
Distress Rating	Remaining Service Life	Distress Rating	Remaining Service Life
0	10	0	10
1	7	1	9
2	5	2	7
3	0	3	5
	•	4	7
		5	4
			_

Roadside Drainage				
Distress Rating	Remaining Service Life			
0	10			
1	8			
2	4			
3	0			

Potholes			
Distress Rating	Remaining Service Life		
0	10		
1	9		
2	7		
3	5		
4	7		
5	4		
6	3		
7	4		
8	2		
9	0		

	Corrugations				
	Distress Rating	Remaining Service Life			
1	0	10			
1	1	9			
1	2	7			
Ī	3	7			
	4	6			
	5	5			
	6	5			
	7	4			
	8	3			
	9	0			

SUBJECTIVE CONDITION RATING FOR REMAINING SERVICE LIFE IN YEARS (Gravel & Native Roads)

	FAILED	POOR	FAIR	GOOD	EXCELLENT
RSL	0	1 - 2	3 - 4	5 - 7	8 - 10

Gravel Rating Sheet Rutting

Cross		
Distress Rating	Remaining Service Life	Distre Ratin
0	10	0
1	7	1
3	5	2
3	0	3
		4
		5
		6
		7

···· 9 ···· <u>· · · · · · · · · · · · · ·</u>					
tting	Roadside	Drainage			
Remaining Service Life	Distress Rating	Remaining Service Life			
10	0	10			
9	1	8			
7	2	4			
5	3	0			
7					
4					

Potholes		
Distress Rating	Remaining Service Life	
0	10	
1	9	
2	7	
3	5	
4	7	
5	4	
6	3	
7	4 2	
8	2	
9	0	

Dust			Corrugations	
Distress Rating	Remaining Service Life		Distress Rating	Remaining Service Life
0	10	ſ	0	10
1	8	ĺ	1	9
2	6		2	7
3	2	I	3	7
		ĺ	4	6
			5	5
		I	6	5
		ĺ	7	4
		ĺ	8	3
		ſ	9	0

Loose Aggregate		
Distress Rating	Remaining Service Life	
0	10	
1	9	
2	8	
3	7	
4	8	
5	7	
6	6	
7	5	
8	3	
9	0	